Blackberry 8100 **Carrier:** AT & T

Vehicles compatible:	**Produced After**:
3-series Sedan	March 2005
3-series touring	March 2005
3-series Coupe	June 2006
3-series convertible	March 2005
5-series Sedan,	March 2005
5-series Touring	March 2005
6-series Coupe	March 2005
6-series Convertible	March 2005
7-series	March 2005
X3,	March 2005
Z4	March 2005
X5	March 2005

Software tested: 4.2.1.96
To find the Software version: Click **Settings**->**Options** -> **about**

Pairing Instructions:

To turn Bluetooth ON, Click **Options** ->**Bluetooth** ->Click track wheel-> Click **Enable Bluetooth**.

1. Click **Options** -> **Bluetooth**.
2. Click the track wheel and select **Add Device**. The Select Device list appears and lists Bluetooth enabled devices that are in range and available to be paired.
3. Select the name of the Bluetooth enabled device with which you are pairing. The **Enter passkey for <device name, here BMWxxxxx>** dialog appears.
4. Type the passkey to authenticate the Bluetooth enabled device. Type the same passkey on the Bluetooth enabled device to which you are pairing.

Sometimes Bluetooth enabled devices contain a hard coded passkey. See the car manual for the passkey.

Limitations:

Pairing:

1. The user will be unable to carry out the initial pairing process on subsequent occasions in the following scenario:
   i) Handset is deleted from the vehicle pairing menu.
   ii) Vehicle is not deleted from the paired devices menu located in the Bluetooth menu.

Recommended Action**:** Please enter Bluetooth Passkey first on mobile phone. Ensure that the handset is deleted from the vehicle's pairing menu, and the vehicle (i.e. BMWxxxxx) tag is deleted from the paired devices menu, located in the Bluetooth menu of the handset.

Reconnection:

1. After pairing, when the device asks if the user wants to connect to BMWxxxxx, and the user checks the box "yes", make sure that they also check the option "don't ask this again" so that the Blackberry gets reconnected automatically.

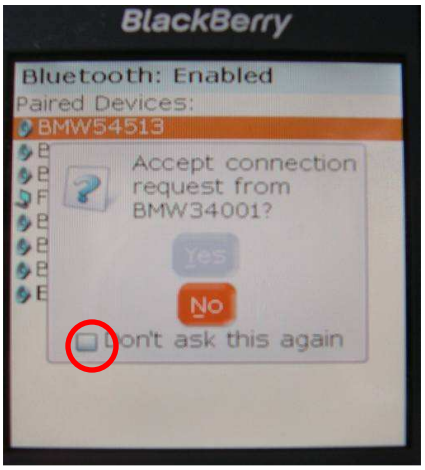

Phonebook:

1. The telephone directory of the SIM card is not accessible over Bluetooth interface.

Recommended Action: Please Copy entries of the SIM card to the telephone-internal directory.

2. If the Phonebook contains group of contacts, it will cause an error during the connection to the car kit and the handset will disconnect from vehicle issuing "uncaught exception java.lang class cast exception".

Recommended Action: please don't save your contacts within a group, save them separately.